PROCEDURE REF# A-INL-053 HONDA ENGINE VERIFICATION



If the bale wrapper's Honda engine will not start. First, make sure the problem is not from the Honda engine itself.

Option #1

Disconnect the 315158-3 connector of the wire harness between the 3button control and the computer located on the side of the wrapper (black, red, orange and green wires), try to start the Honda engine with the key or the crank.

Option #2

Disconnect the green wire located behind the Honda switch and reconnect the male and female connector of the black Honda wire. This will eliminate any possibility of an electrical problem caused by Anderson components. Try to start the Honda engine with the key or the crank. If the engine does not start contact a Honda dealership.



