

PROCEDURE REF# A-IND-033

Error code signification

2014 and after


Error: WRAP FW

Possible cause:

The wrapping valve coil for counterclockwise rotation is faulty or improperly connected.

Solutions:

Check the connection of the coil of the wrapping valve.
Replace the coil of the wrapping valve.

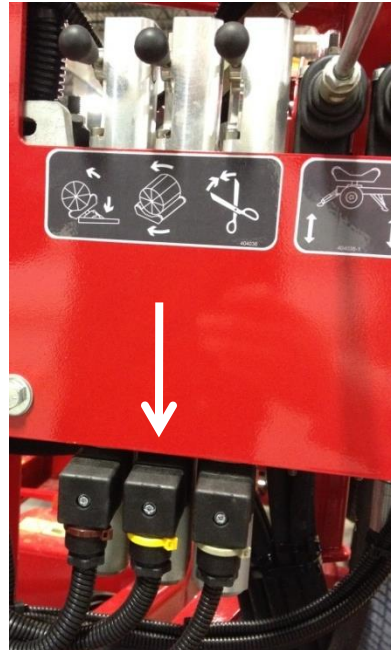


Error: WRAP REV

Possible cause:

The coil at the rear of the wrapping valve for clockwise rotation is faulty or improperly connected.

Solutions:

Check the connection of the coil at the rear of the wrapping valve. Replace the coil of the rear wrapping valve.

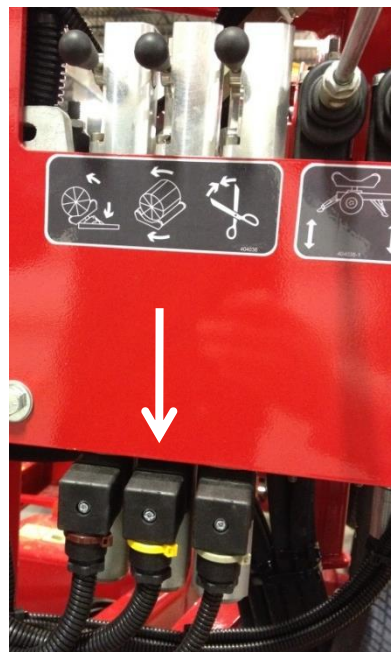

PROCEDURE REF# A-IND-033

Error code signification

2014 and after


Error: C UNLD RW

Possible cause:

Coil of the dump valve faulty or improperly connected.

Solutions:

Check the connection of the coil for the dumping valve. Replace the coil of the dumping valve.

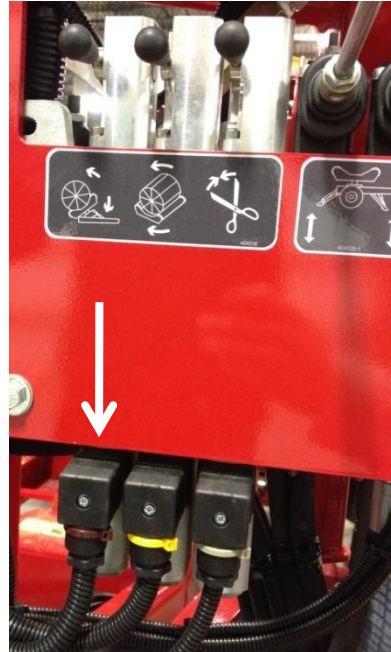


Error: C UNLD REV

Possible cause:

Dump valve coil (descending) is faulty or improperly connected.

Solutions:

Check the connection to the dump valve coil (descending).
Replace the dump valve coil (descending).

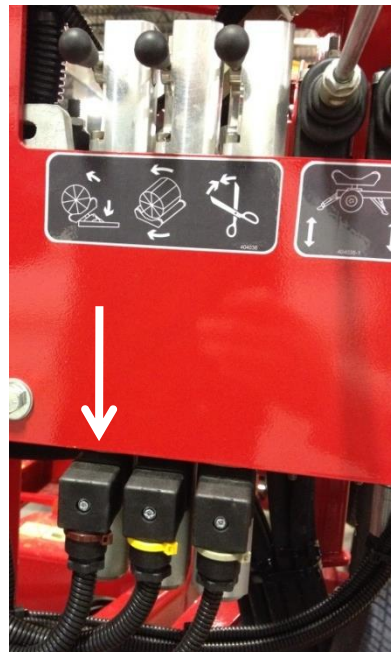

PROCEDURE REF# A-IND-033

Error code signification

2014 and after


Error: C OPEN CUT

Possible cause:

Valve coil for opening the plastic cutter is faulty or improperly connected.

Solutions:

Check the connection of the valve coil for opening the plastic cutter.
Replace the valve coil for opening the plastic cutter.

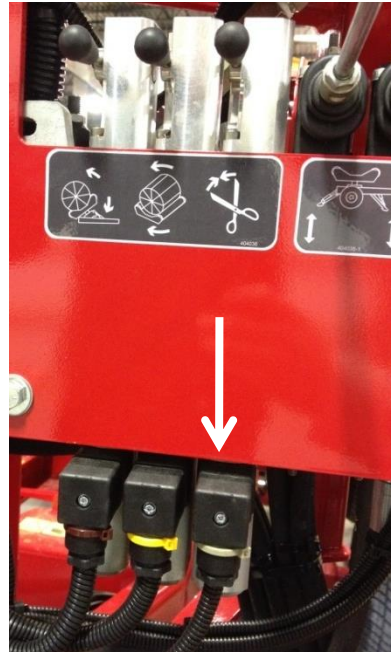


Error: C CLSE CUT

Possible cause:

Valve coil for closing the plastic cutter is faulty or defective.

Solutions:

Check the connection of the valve coil for closing the plastic cutter. Replace the valve coil for closing the plastic cutter.

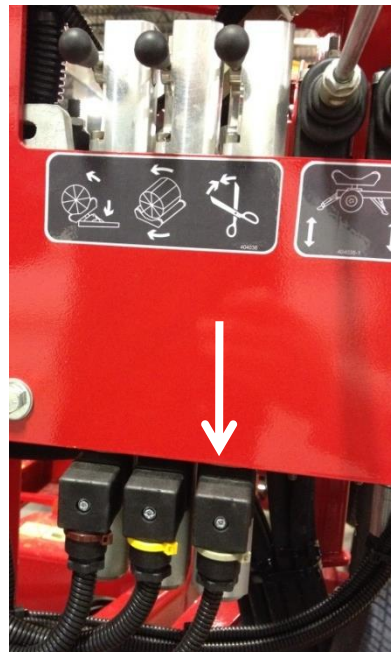

PROCEDURE REF# A-IND-033

Error code signification

2014 and after


Error: SOLENOID (COIL PROP)

Possible cause:

The solenoid (coil) of the proportional valve is faulty or improperly connected.

Solutions:

Check the connection of the coil of the proportional valve. Replace the coil of the proportional valve.

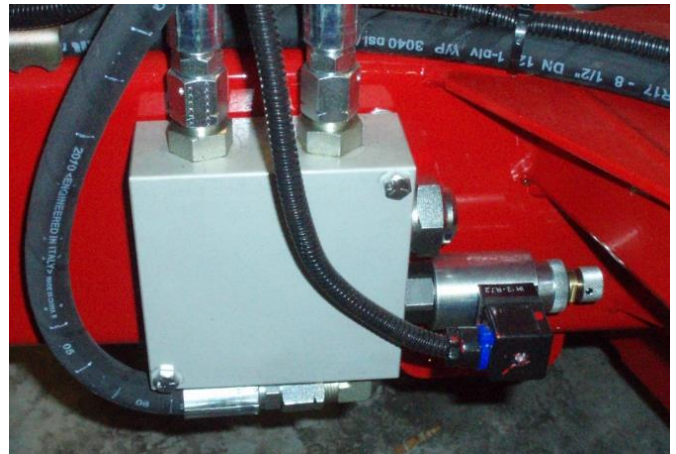

PROCEDURE REF# A-IND-033

Error code signification

2014 and after

Error: ENG NT RUN

Possible causes:

The fuel valve is closed/ The gas tank is empty/ The low engine oil sensor is activated/ The spark plug is clogged or defective/ The engine is flooded because the fuel valve was not closed the previous day or during transportation/ The fuse in the Honda switch key box is burned out.

Solutions:

Open the fuel valve and start again/ Put fuel in the tank and start again/ Add oil to the engine and start again/ Clean the spark plug or change it/ Remove the spark plug, dry it out, dry out the cylinder by activating the starter crank, put back the spark plug and start again/ Replace the fuse.



Error: ROT RV SID

Possible causes:

Rotating table turns in the wrong direction: hydraulic hoses or cables are reversed.

Solutions:

Reverse the hydraulic hoses or cables.

PROCEDURE REF# A-IND-033

Error code signification

2014 and after

Error: PROX ZERO

Possible causes:

Zero-point sensor is faulty or improperly connected.

Solutions:

Check the connections and the adjustment of the zero-point sensor. Replace the zero-point sensor.

