


Erreur #34

The error #34 means that the oil tank level is too low.

1. Verify the oil gauge located on the side frame (left picture). It must be completely soaked in oil. Add hydraulic TDH oil if needed. If the level is accurate, pass to the next step.
2. Inspect the harness that goes to the oil level sensor to make sure it is not cut or pinched. Repair or replace the cable (#315370) if needed.
3. If the harness is not damaged, replaced the oil level sensor.

Note: The arrow on the sensor (above the oil tank) must point backward the machine to ensure its proper functioning.

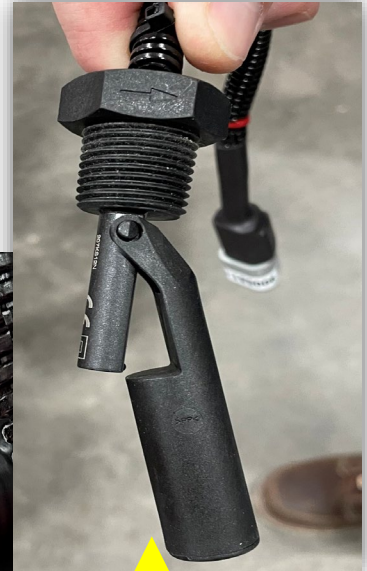


ELECTRICAL DIAGRAM

For more details, consult the electrical diagram of the machine:

- 1- Go to www.grpanderson.com
- 2- Click on Resource Center
- 3- Select the folder – Electric Wiring Diagram –
- 4- Select the folder associated with your machine – Mergepro 915-1060 –

Or follow the link below :

<https://grpanderson.com/en/resource-center/?section=2-Public%20section/-%20Electric%20wiring%20diagram%20->

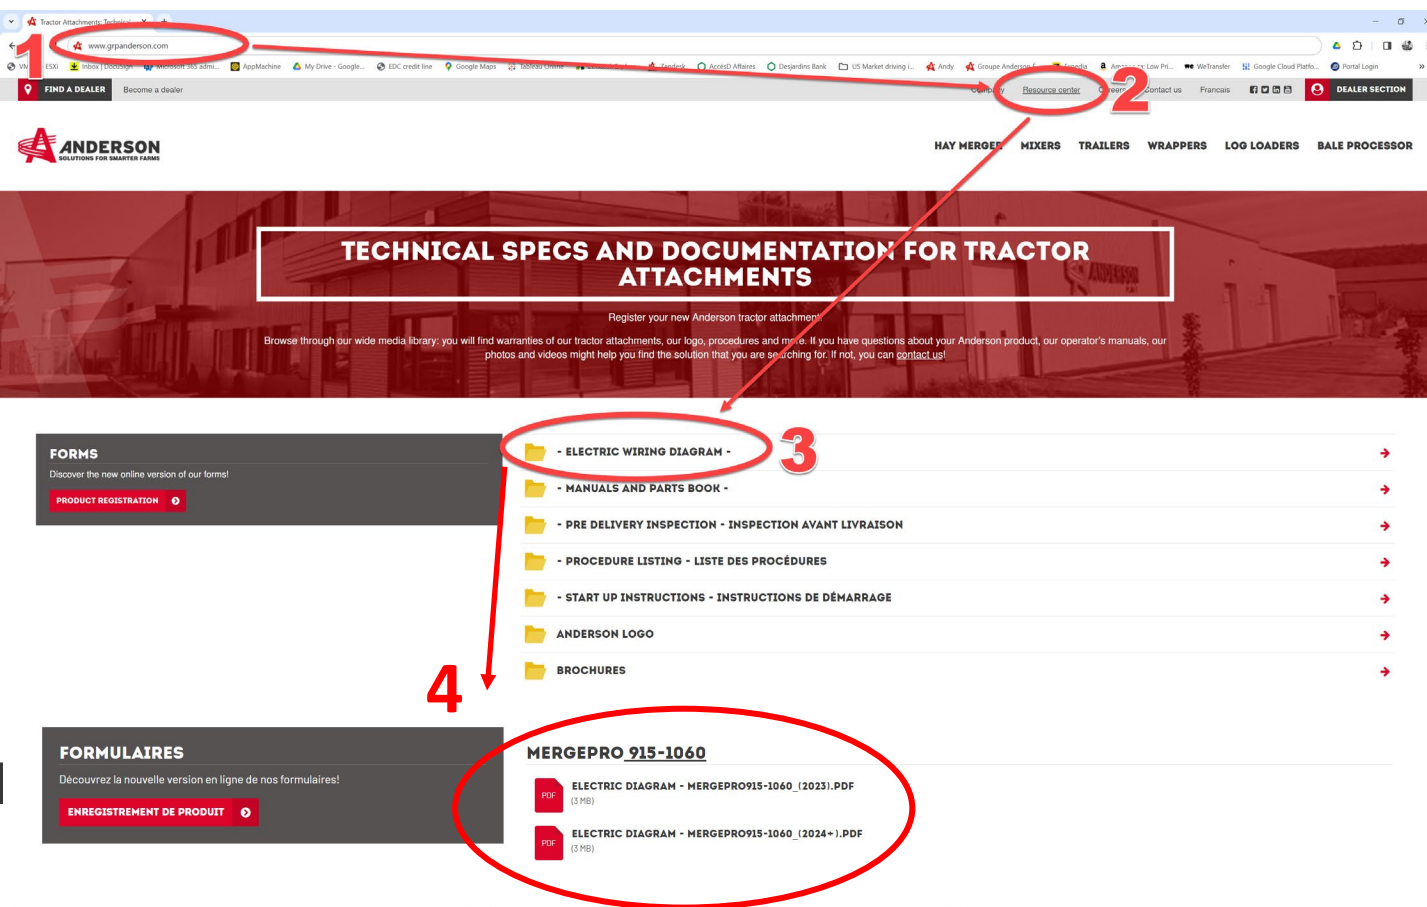

The screenshot shows the Anderson website interface. The browser address bar shows www.grpanderson.com. The navigation menu includes "Resource center". The main content area is titled "TECHNICAL SPECS AND DOCUMENTATION FOR TRACTOR ATTACHMENTS". Under "FORMS", there is a list of categories: "- ELECTRIC WIRING DIAGRAM -", "- MANUALS AND PARTS BOOK -", "- PRE DELIVERY INSPECTION - INSPECTION AVANT LIVRAISON", "- PROCEDURE LISTING - LISTE DES PROCÉDURES", "- START UP INSTRUCTIONS - INSTRUCTIONS DE DÉMARRAGE", "ANDERSON LOGO", and "BROCHURES". Under "FORMULAIRES", there is a section for "MERGEPRO 915-1060" with two PDF links: "ELECTRIC DIAGRAM - MERGEPRO915-1060_(2023).PDF" and "ELECTRIC DIAGRAM - MERGEPRO915-1060_(2024+).PDF".

TROUVER UN
CONCESSIONNAIRE

SECTION
DOCUMENTATION

ACCÉDER À L'ESPACE
CONCESSIONNAIRE